

INSTALLATION INSTRUCTIONS

C-2350VFD, VFD Sensor Mini Split-Core Digital Output



UL 3PZS
US LISTED



DANGER

Failure to follow these instructions will result in death or serious injury.



Hazard of electrical shock, explosion, and arc flash

- Follow ALL requirements in NFPA 70E for safe work practices and for Personal Protective Equipment (USA) and other applicable local codes when installing this product
- Only qualified electrical personnel should install this product.
- Read, understand, and follow all instructions thoroughly
- Install only on insulated conductors
- Lock out and tag out all power sources prior to installation. Use properly rated voltage sensing instrument to determine no voltage is present



WARNING

Failure to follow these instructions could result in death or serious injury.



Automated equipment may start without warning

- Equipment monitored/operated by this device may start without warning. Keep clear of apparatus at all times

IMPORTANT WARNINGS

- Only qualified trade installers should install this product
- This product is not intended for life-safety applications
- Do not install in hazardous or classified locations
- The installer is responsible for all applicable codes
- This product must be installed in a suitable electrical enclosure

INSTALLATION



Disconnect, lock out and tag out all power supplies during installation

1. Determine mounting location for the sensor near the conductor to be monitored. The sensor should be located AT LEAST 1/2" from any uninsulated conductor.
2. Sensor features a flexible iris which allows the sensor to hang on the conductor if local codes permit. A bracket is included for screw mounting or attaching to DIN rail. For screw mounting, drill two 3/32" pilot holes using the bracket as a template; ensure no drill shavings are present in enclosure.
3. Clamp sensor around INSULATED CONDUCTOR ONLY, 600VAC MAX to be monitored on LOAD side of drive.
4. Snap the sensor into the mounting bracket.
5. Wire the output of the sensor to a control panel digital input loop not to exceed 30VAC/DC wetting voltage. Tighten terminals to 3.5 in-lb.

CALIBRATION

No calibration is necessary. Sensor will automatically detect belt loss on motors operated by variable speed drive after 10 seconds of operation above 50Hz.

OPTIONAL MANUAL SETUP:


To reset and restart calibration, press/hold button for 1 second. LED will make 2 fast blinks. Operate motor above 50Hz for 10 seconds.

To activate go/no mode, press/hold button for 5 seconds. LED will make 3 fast blinks.

WIRING EXAMPLES

Install sensor on LOAD side of drive.

NOTE: Device is NOT polarity sensitive.

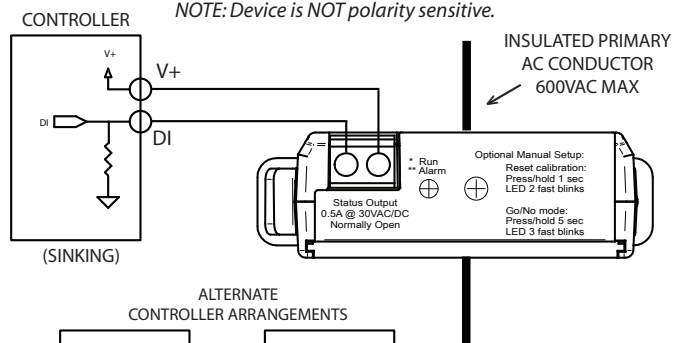


PRODUCT APPLICATION LIMITATION:


Senva products are not designed for life or safety applications. Senva products are not intended for use in critical applications such as nuclear facilities, human implantable device or life support. Senva is not liable, in whole or in part, for any claims or damages arising from such uses.

152-0251-0A

DIMENSIONS

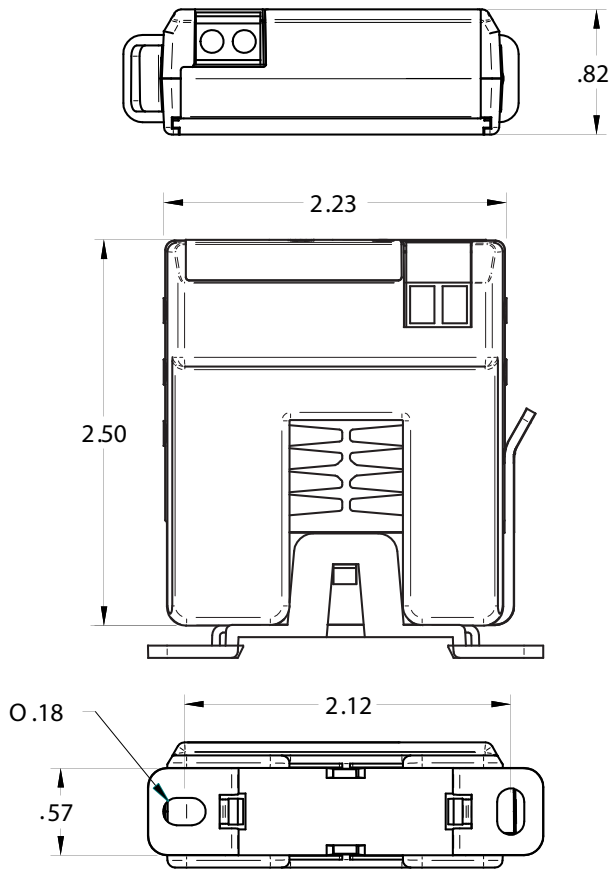

OPERATION

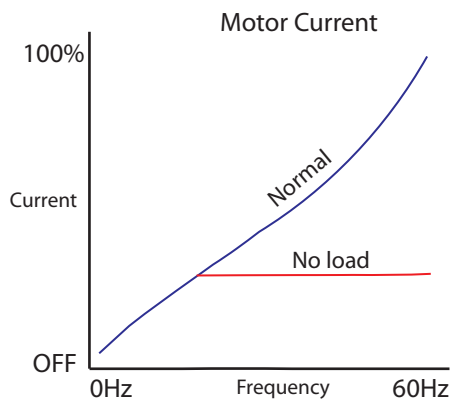

The C-2350 utilizes a proprietary sensing algorithm to detect belt loss on motors operated by variable frequency drives.

Reliable operation requires variable frequency drive to increase frequency to a minimum of 50Hz when load is lost.


Typical load status applications include:

- Proof of flow
- Belt-loss detection
- Coupling shear

TECH TIPS

On low current loads, wrap sensor multiple times to increase sensitivity

CAUTION: Do not exceed sensor maximum current. The current detected by the sensor will increase 1X with each wrap.

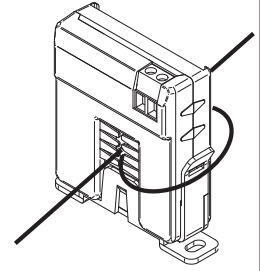

To monitor loads greater than the current sensor maximum rating

Use of 5A CT is NOT recommended. Consult factory for extended range version.

Troubleshooting

| Symptom | Causes | Remedy |
|-------------------------------------|---|--|
| Sensor output does not change state | Minimum frequency too low. | Drive must ramp to 50Hz min. for sensor to alarm. |
| | Testing with ohm meter yields incorrect results | Solid state output may show approx. 1 ohm or less. |
| | Incorrect control wiring | Ensure control loop voltage is present |

Maximum surrounding air ambient, 60 ° C.

For use in Pollution Degree 2 Environment.

| Part Number | C-2350 |
|---------------------|---|
| Amperage Range | 3.5 A (on)~135A (200A Max.) 15Hz minimum |
| Output Type | NO, solid-state FET |
| Output Rating | 1.0A@30VAC/DC Max. |
| Temperature Rating | -15~60 ° C |
| Insulation Class | 600V RMS. For use on insulated conductors only! Use minimum 75 ° C insulated conductor |
| Sensor Power | Induced |
| Frequency Range | 20-60Hz; proof of flow loss alarm at 50Hz+ |
| Dimensions (LxWxH) | 2.51" x 2.23" x 0.82" (1.4" H with optional relay module) |
| Sensor Aperture | 0.75" |